



9304 Horton Road Southwest
Calgary, Alberta T2V 2X4

(403) 253-2033

General Inspection

NAPA AUTOPRO - Kirkham Automotive Ltd

📍 [9304 Horton Road, Southwest Calgary, AB, T2V 2X4](#)

🌐 www.kirkhamautomotive.com

✉ kirkhamr@telus.net

☎ [403-253-2033](tel:403-253-2033)



Yuriy L.
Technician



Brent Heibein
Service Advisor

2007 Honda Odyssey

Charlotte Newton-stroppel



VIN: 5FNRL38267B511763

ODO: 325,130 km

Date: 05/07/2024

RO#: 39609

36 Good

General Vehicle

Tire Pressure

NOTES

Set/Checked Tire Pressure 35

Rotated Tires

Drive-Line & Brakes

Front Brake Pads

NOTES

Left 12 mm
Right 12 mm

Rear Brake Pads/Shoes

NOTES

Left 8 mm
Right 8 mm

Brake Fluid Condition

NOTES

Water Content 5 %.

Exhaust

Exhaust Pipe

NOTES

Rusty

General Vehicle

Body General

Wipers & Washers

Tune Up/Engine Performance

Under Hood

Drive Belt(s) Condition/Tension

Antifreeze

Timing Belt

Steering & Suspension

Outer Tie Rods

Power Steering Fluid

Front Shocks/Struts

Front Springs

Ball Joints

Drive-Line & Brakes

Transmission Leaks

C/V Axles & Boots

Wheel Bearings

Brake Hoses & Lines

Brake Calipers

Exhaust

Catalytic Converter

Horn

Spare Tire

Cooling System

Block Heater

Power Steering Rack

Power Steering Leaks

Rear Shocks/Struts

Rear Springs

Universal Joints

Axle & Output Seal Leaks

Brake Rotors

Parking Brake

Brake Wheel Cylinders

Muffler

10 Needs Future Attention

General Vehicle

Front Tires

CONDITION

Tire Tread Low

NOTES

235/65 R16
LF Tire Depth 4 mm
RF Tire Depth 4 mm

Rear Tires

CONDITION

Tire Tread Low

NOTES

235/65 R16
Left Tire Depth 3.5 mm
Right Tire Depth 3.5 mm

Malfunction Indicator Lamps

NOTES

CEL light on

Under Hood

Engine Oil Leaks

NOTES

Rear main seal seeping.
Seeping on top near oil filter housing



Engine Air Filter

CONDITION

Engine Air Filter Getting Dirty, Replace at Next Service

Cabin Air Filter

CONDITION

Cabin Air Filter Getting Dirty/Replace at Next Service

Battery

CONDITION

Battery Tests Weak

NOTES


68% CCA replace

Steering & Suspension

Control Arms

NOTES

Front lower control arm bushings cracked

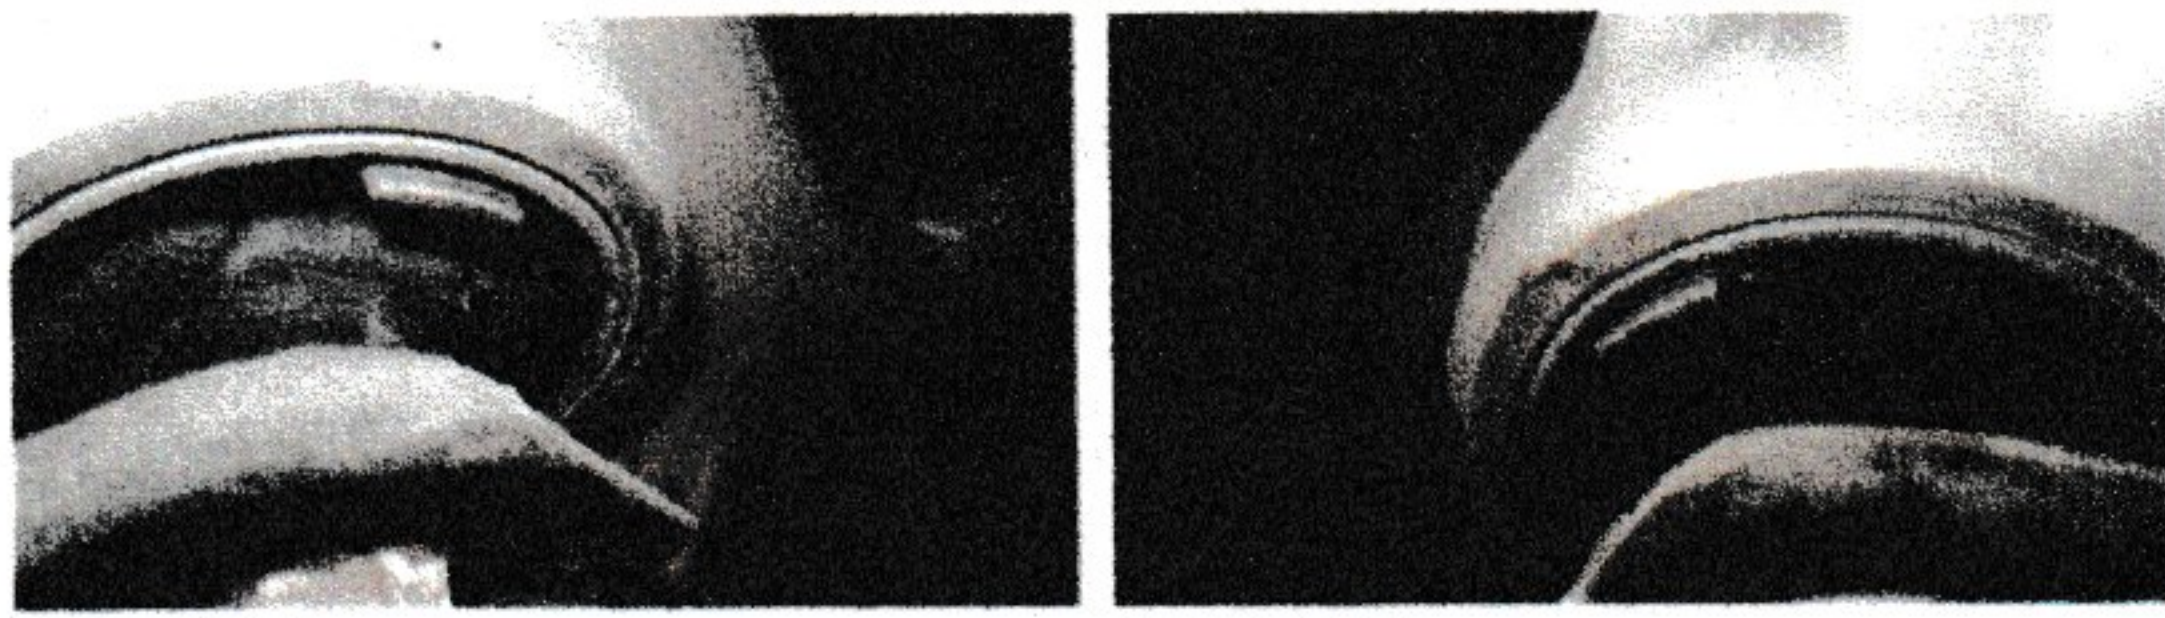

Stabilizer Bar and Links

NOTES

LF link has major play, clunking

Drive-Line & Brakes

Transmission Fluid Condition

NOTES

Level low

1 Needs Immediate Attention

General Vehicle

Exterior Lights

NOTES

Right stop doesn't work ← LIGHT BULB REPLACED MAY/8/2024


1 Monitor Condition

Steering & Suspension


Inner Tie Rods

NOTES


LF inner tie rod has slight play

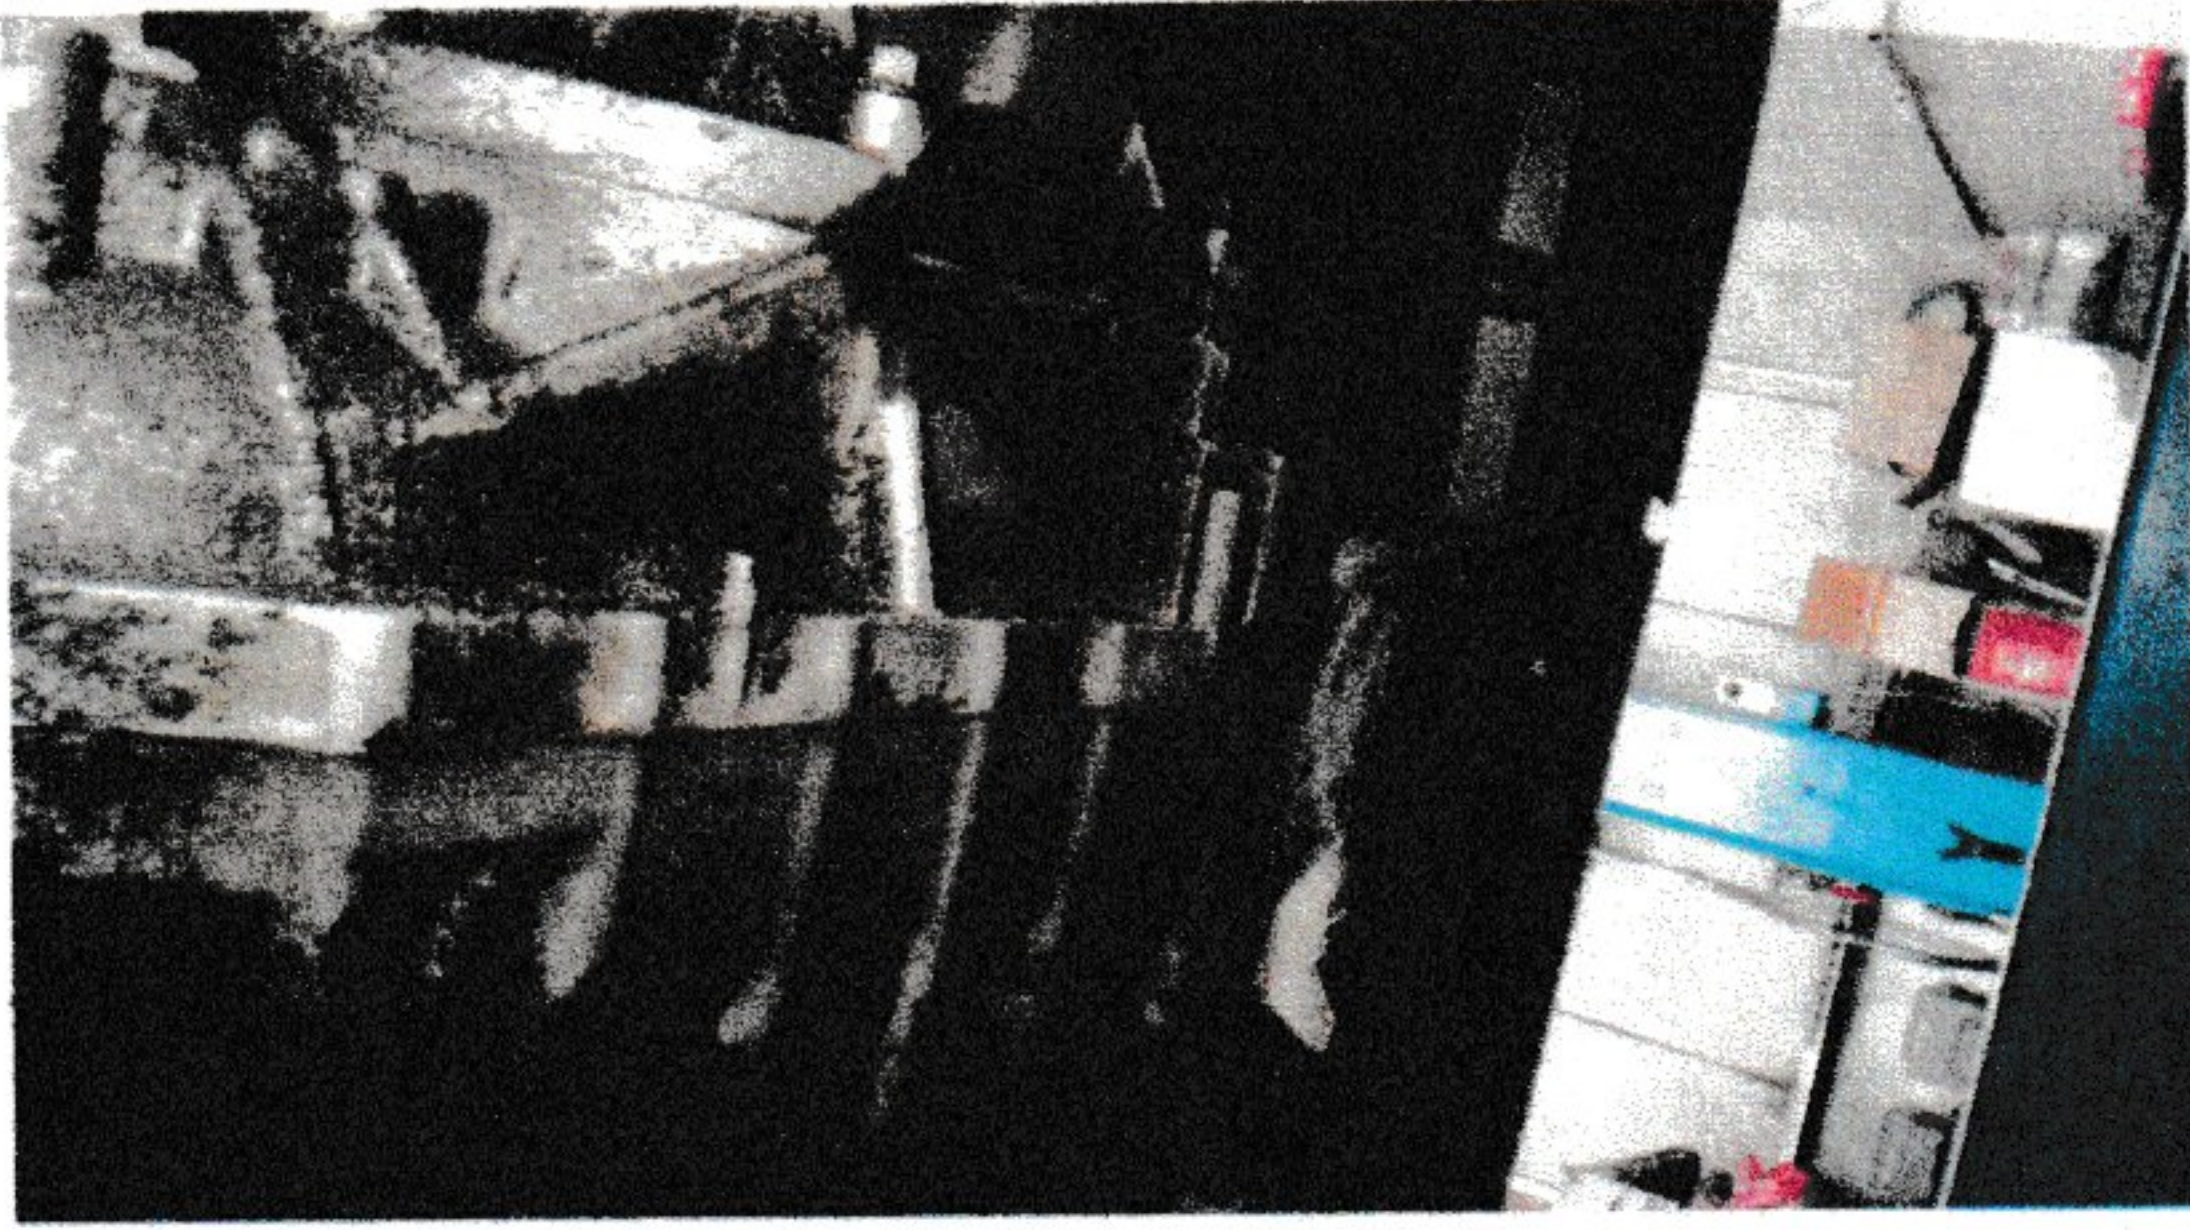


Engine Oil Leaks

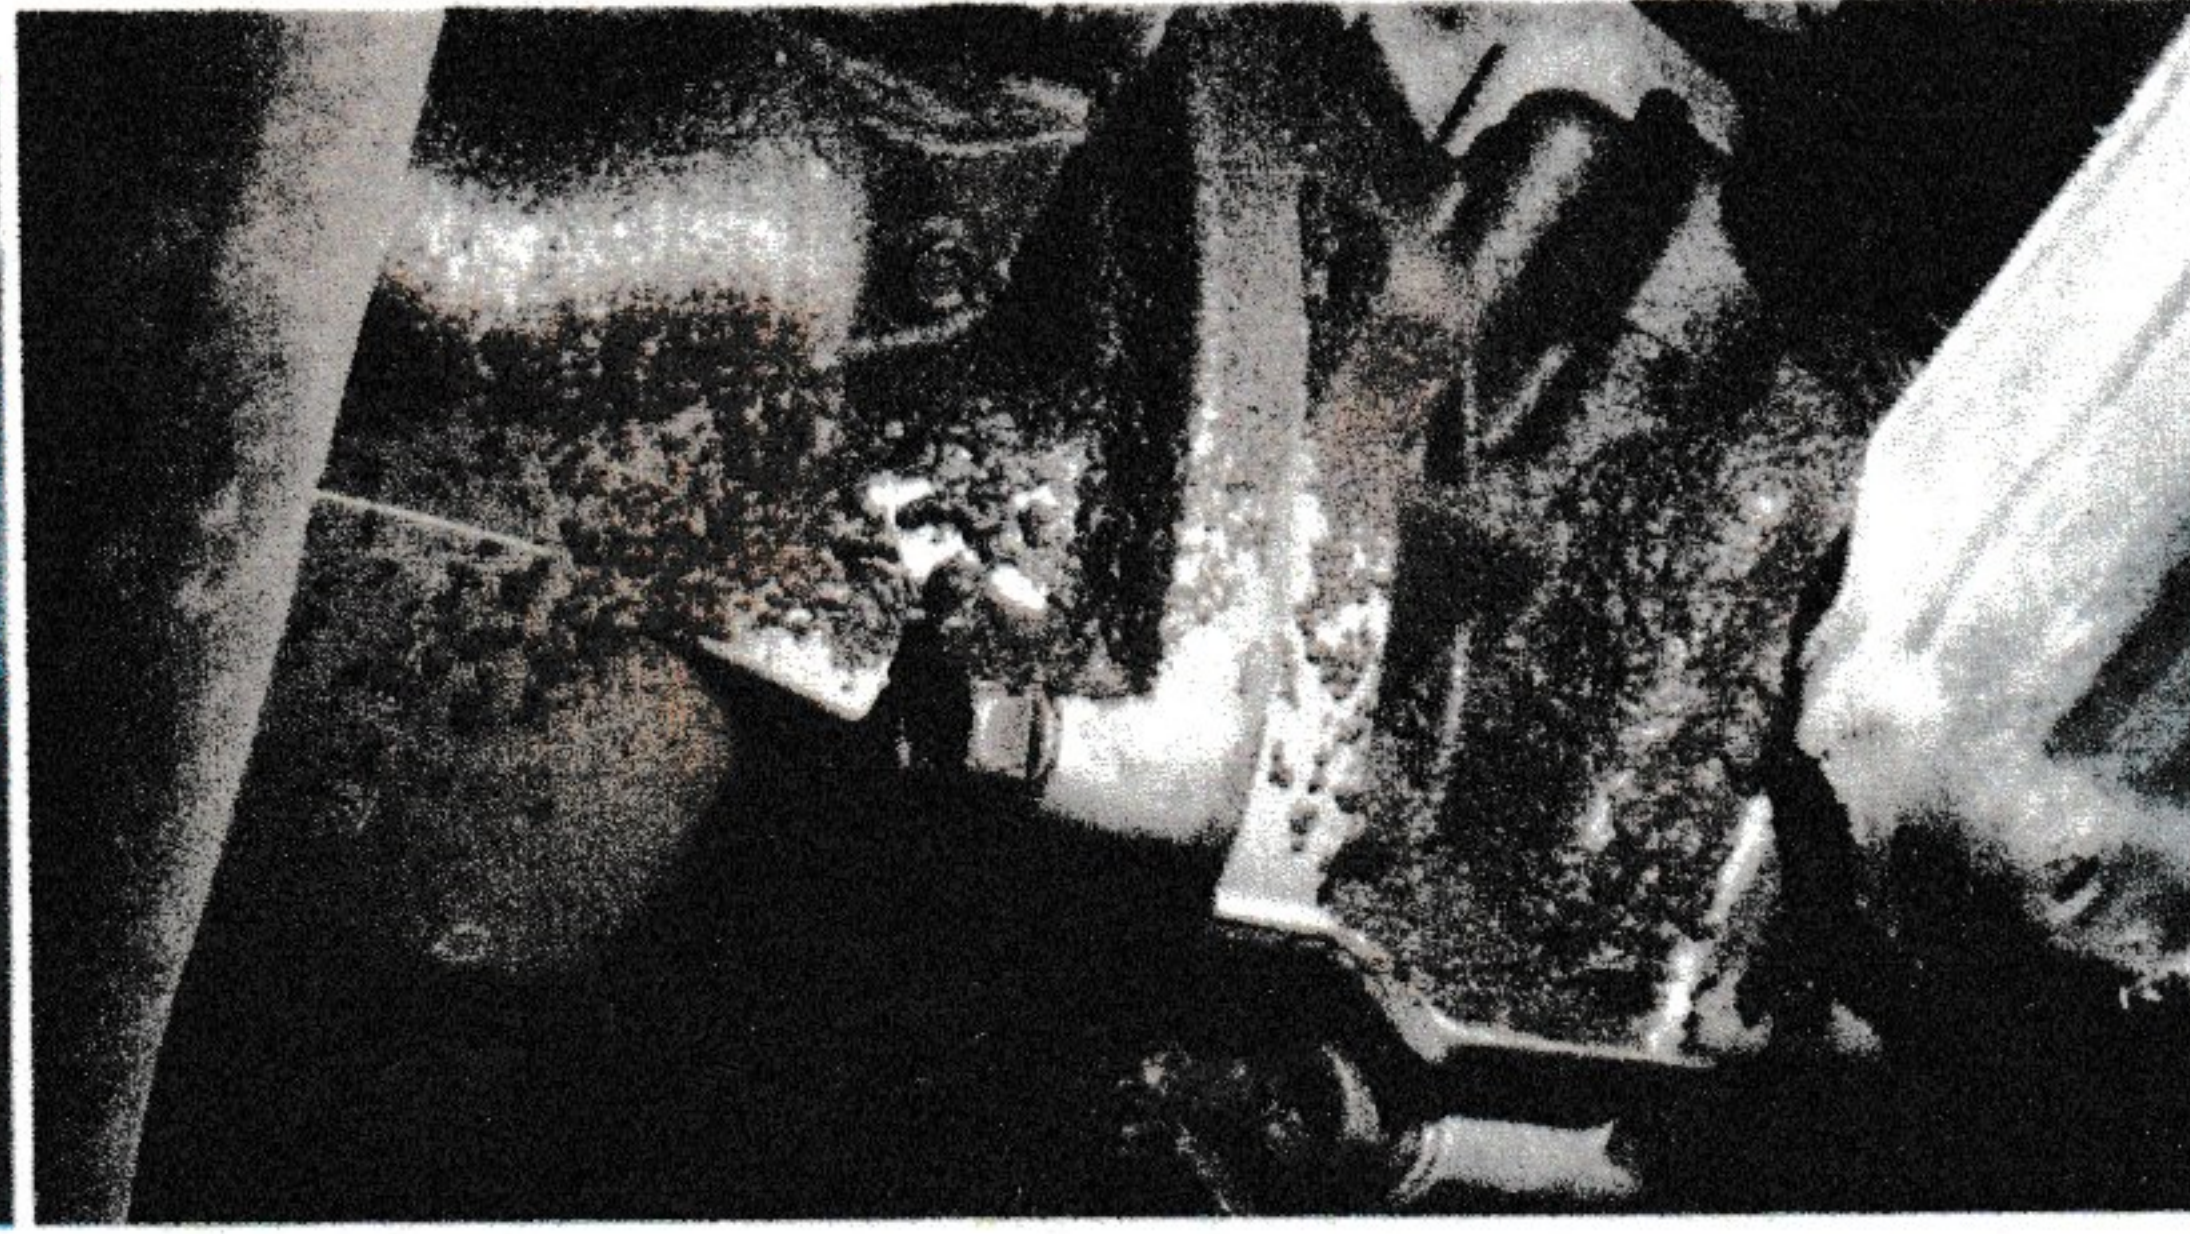

Engine Oil Leaks

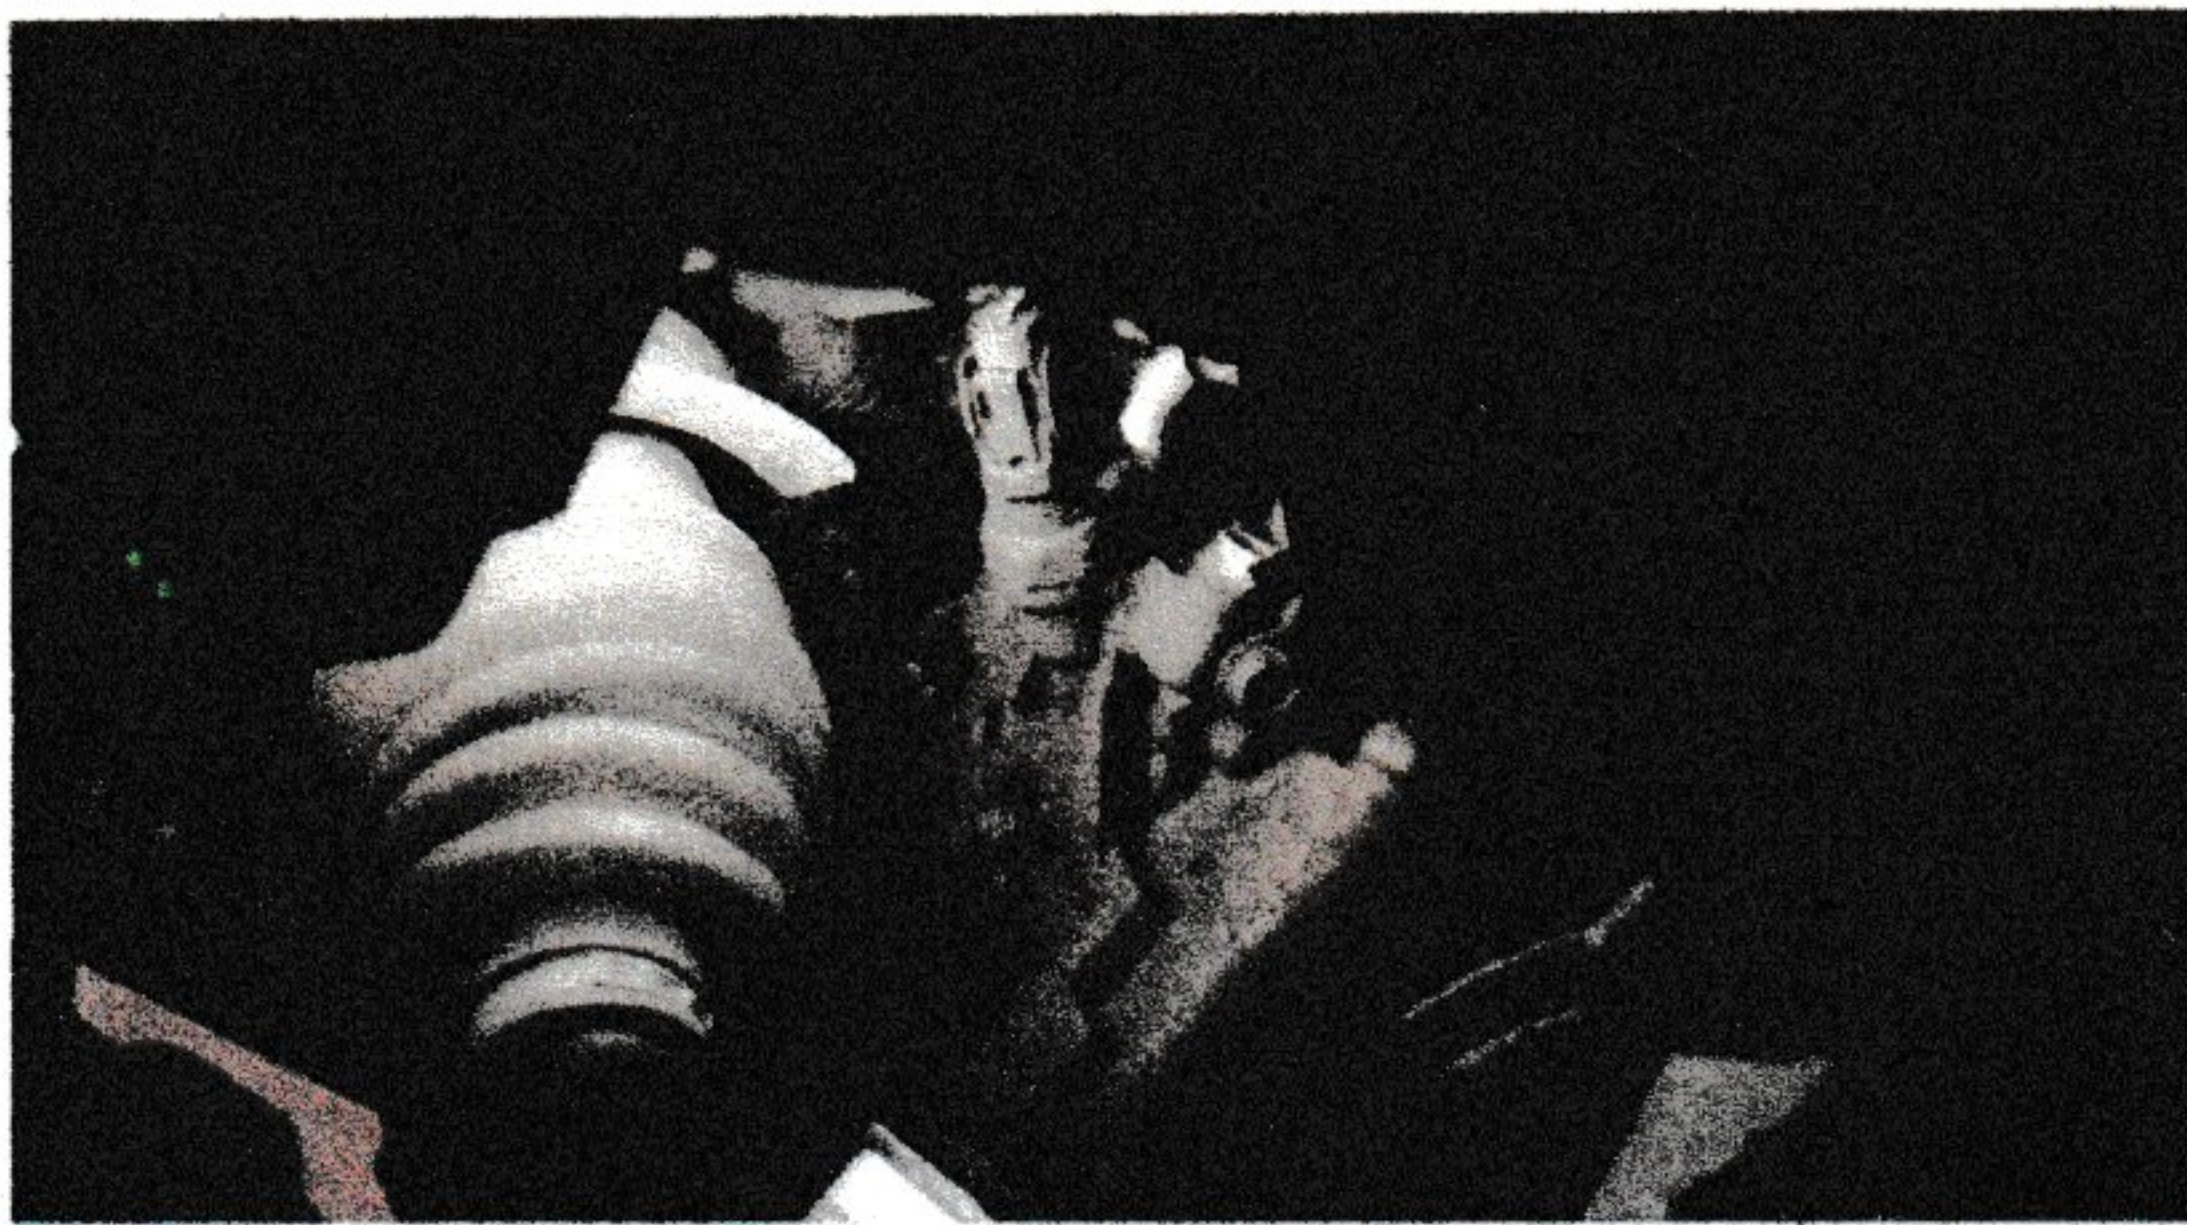


Engine Oil Leaks

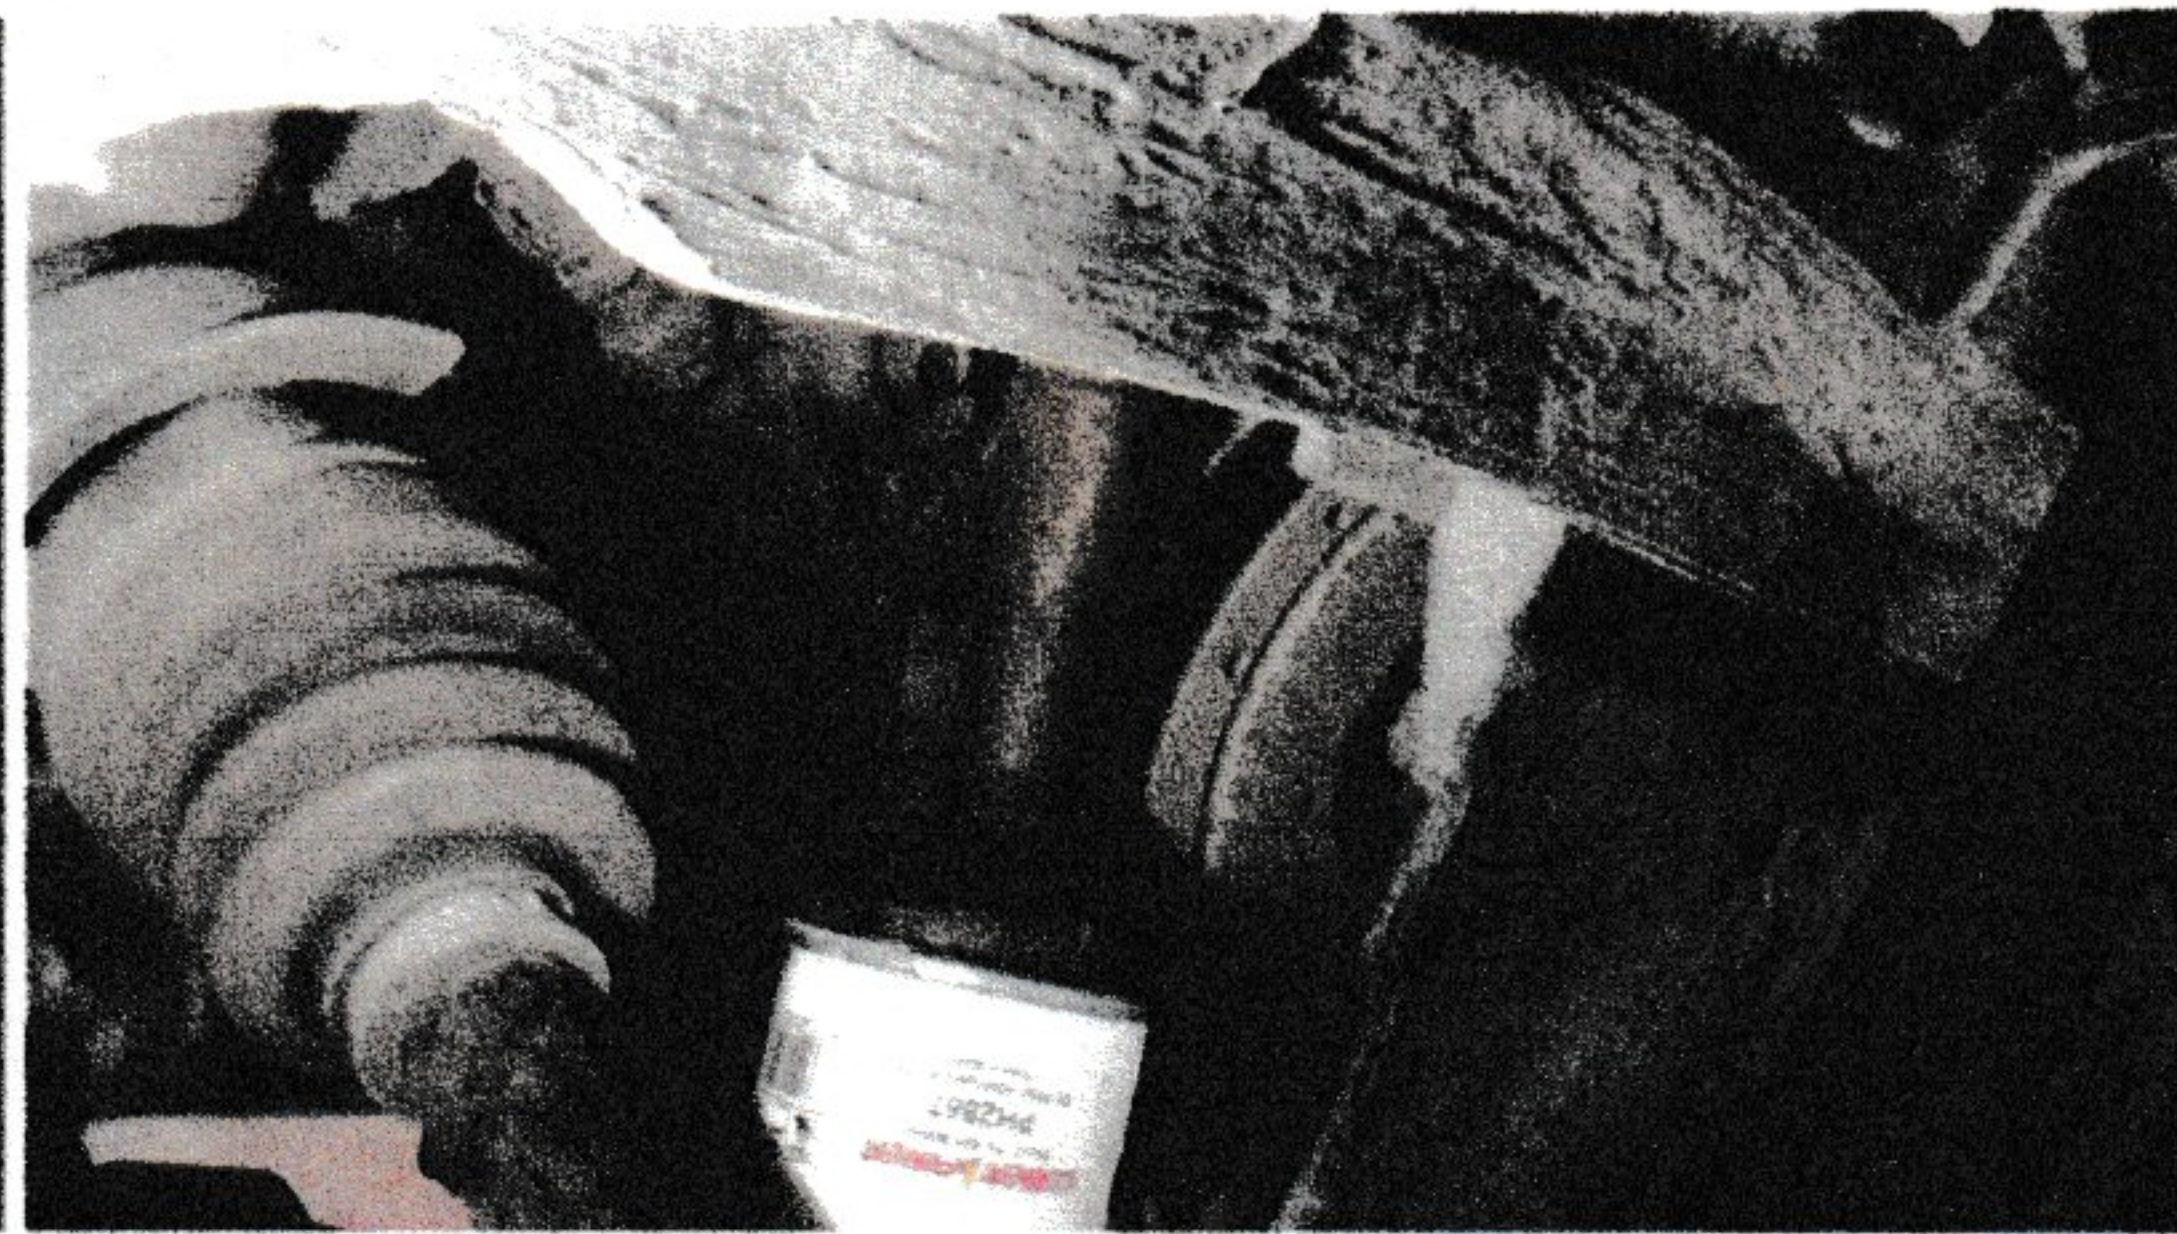

Engine Oil Leaks



Control Arms

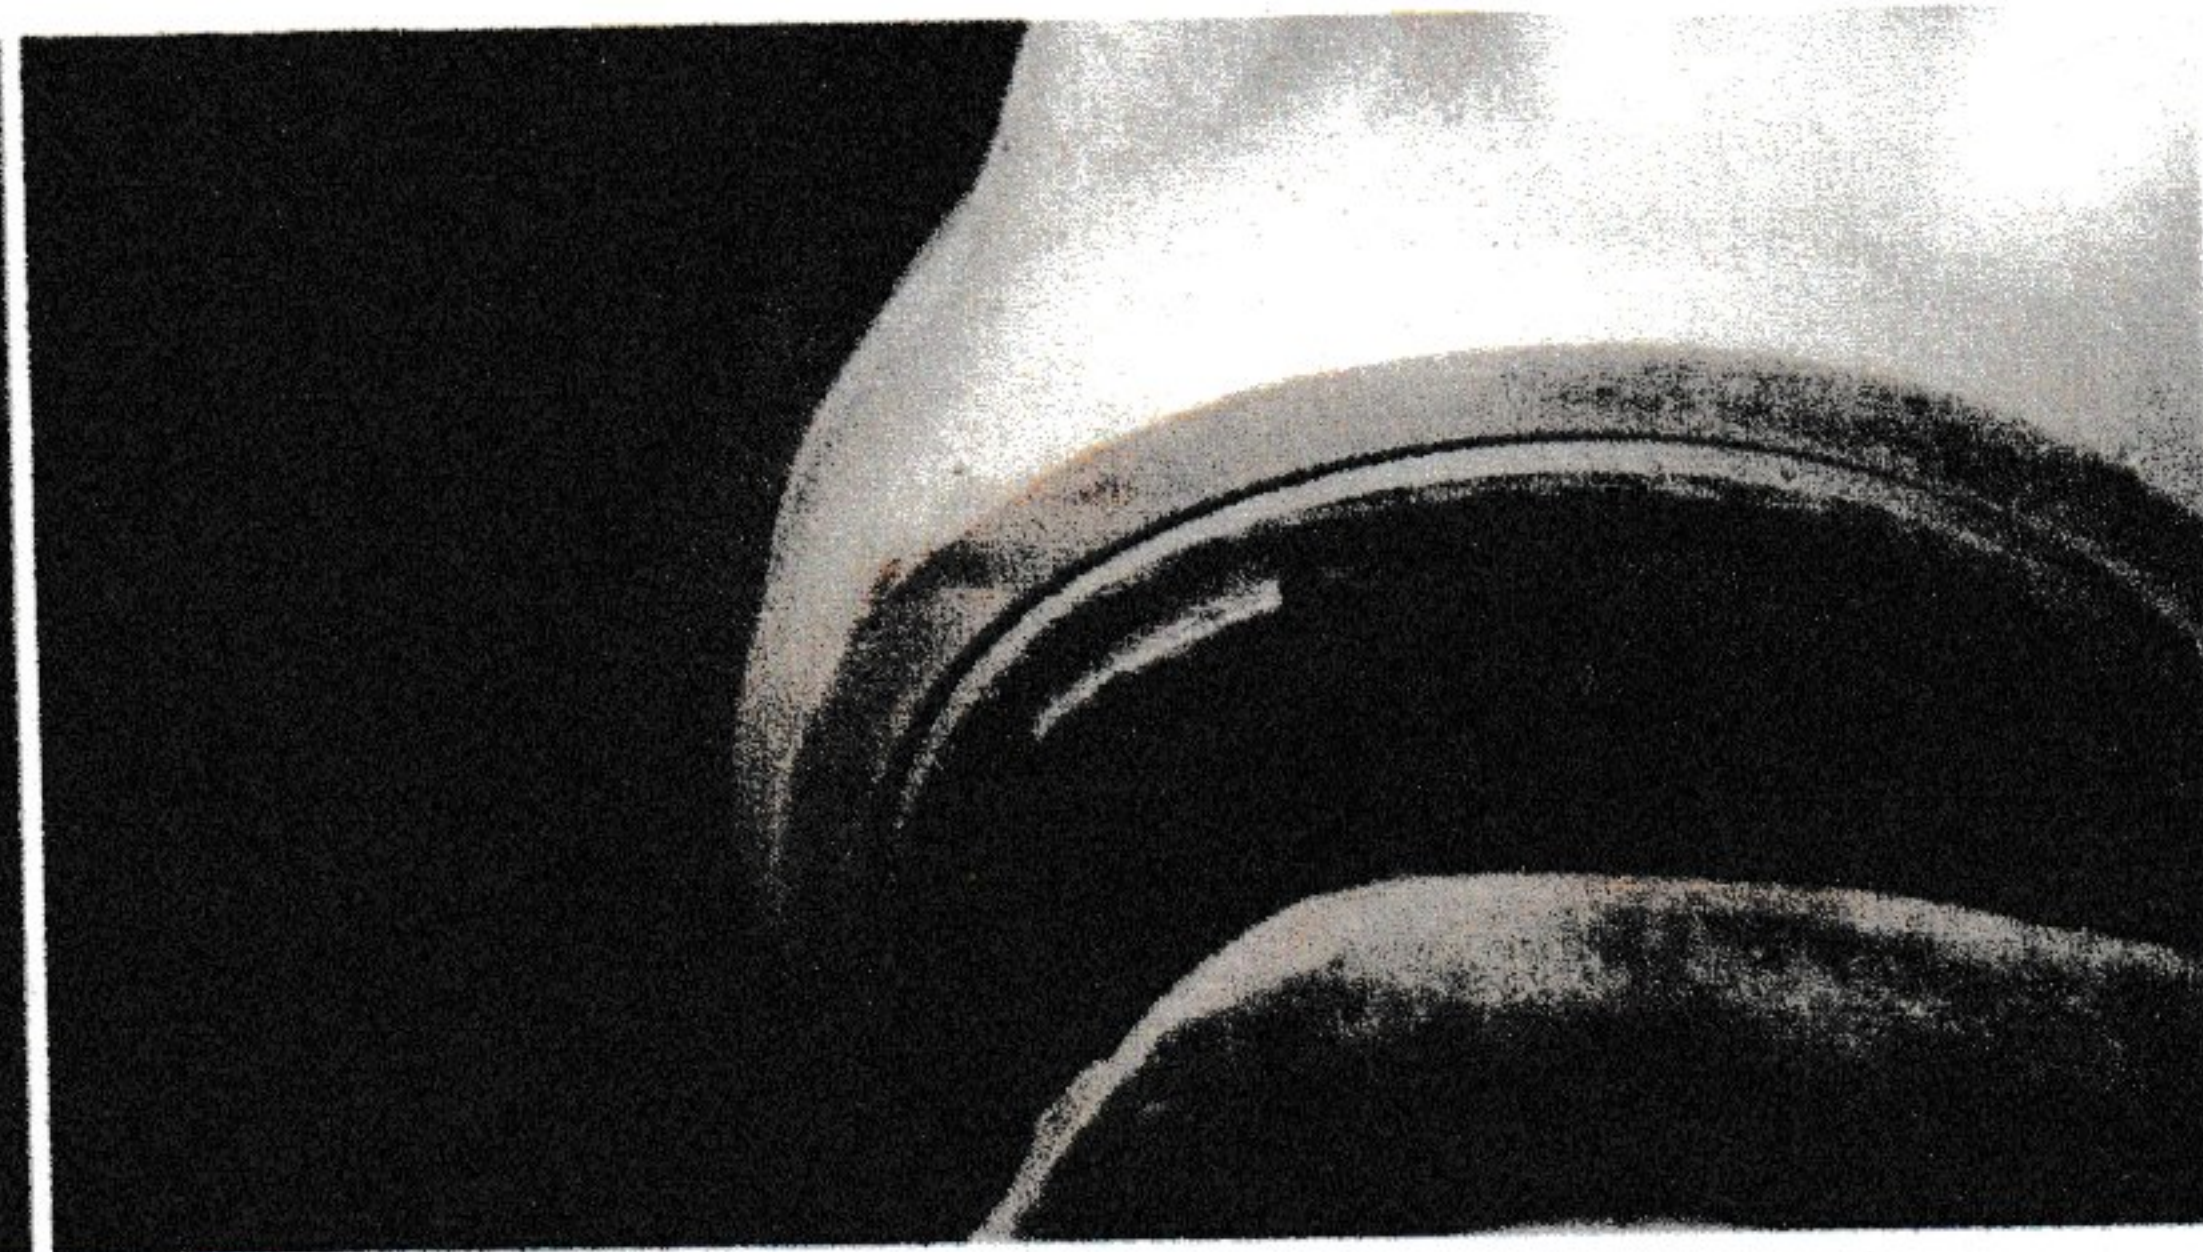

Control Arms